

Brake Failure

Pole Position II Sit-Down

If after installing Pole Position II in a Pole Position sit-down cabinet the brake fails to work during game play, then make the following modification to the Pole Position CPU board:

- Solder a 2.7 k Ω resistor across C12 (a 0.1 μ F capacitor located next to the Type-4066 integrated circuit at location 8K).

